



**Service Letter
115-15**

**GROB
G 115E**

Subject: Modification of flexible hoses

Models Affected: G 115E, S/N 82146 – 82149,

Time of Compliance: incorporated at delivery

Background Information: Due to vibration in the engine compartment flexible hoses frequently become worn. In order to reduce wear on the flexible hoses, a different type of hose (2-layered) will be incorporated. The material will comply to the same specification as the one presently in use, however will be more resistant to mechanical stress and vibration.

Action: Record and report condition of hoses at least every 50 hrs. inspection. Reports to be sent to GROB-WERKE, Product Support. Test to be run for 100 hrs. New hoses found defective during this period to be sent back to GROB-WERKE for investigation.

Material: The hoses: P/N 115E-6000.30/2
P/N 115E-6000.31/2
P/N 115E-6000.32/2
P/N 115E-6000.33/2
P/N 115E-6000.34/2
and protective cover: hose, outer GA08S056 at correct length will be supplied by GROB free of charge.

Tools: -----

Weight and Balance: negligible

DATUM DATE	ERSETZT AUSGABE REPLACES ISSUE	BEARBEITET VON PREPARED BY	MUSTERGEPRÜFT APPROVED	SEITE PAGE
23.10.2000		M. Reinhold		1 of 2




**Service Letter
115-15**

**GROB
G 115E**

Remarks: The Illustrated Parts Catalogue will be amended during the next revision following a successful test of the new flexible hoses.

Contact: For questions and assistance please contact:
Michael Reinhold , Product Support,
phone: +49-8268-998-105
fax: +49-8268-998-200

Mattsies, 23. October 2000


Dipl.Ing. (FH) H. Micheler
(Manager Airworthiness/ Certification)

DATUM DATE	ERSETZT AUSGABE REPLACES ISSUE	BEARBEITET VON PREPARED BY	MUSTERGEPRÜFT APPROVED	SEITE PAGE
23.10.2000		M. Reinhold		2 of 2